


SERVICE BULLETIN

During recent field tests, we have found that the rear take-up axle grease seal has a tendency to be forced out of its seat by the side action of the self aligning bearings. To prevent this and to assure trouble free performance for the customer, we request that a $\frac{1}{2}$ - 8 self tapping screw be installed as per instructions on all units below serial 26905..

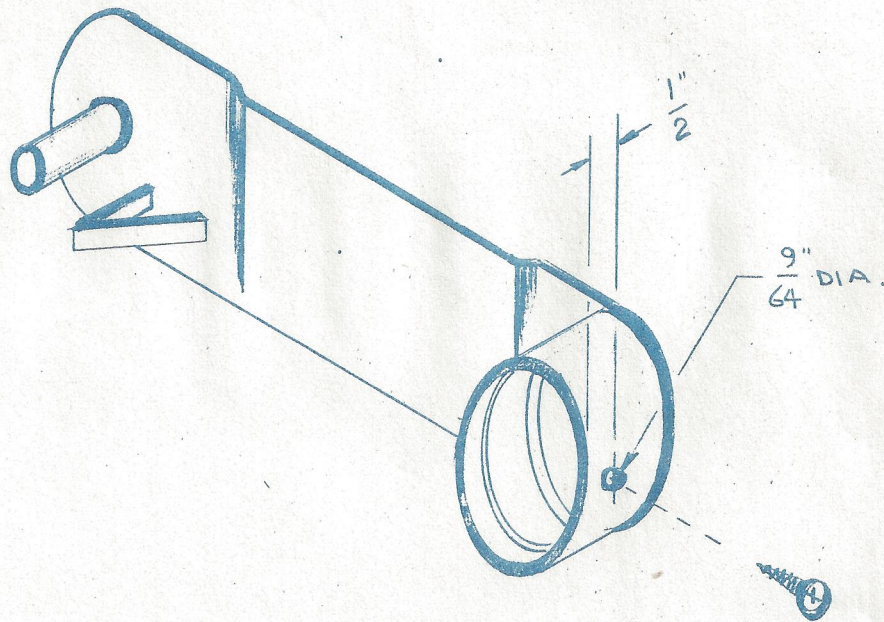

BULLETIN DE SERVICE

Nous avons trouvé, lors de récents tests, que le joint d'étanchéité sur l'essieu arrière avait une tendance à être arraché de son siège par la force du coussinet à billes. Pour prévenir ceci et éviter tout trouble de performance pour le client, nous demandons qu'une vis $\frac{1}{2}$ -8 soit installée comme illustrée ci-haut sur tous les unités fabriqués avant le numéro de série 26905.

BOA-SKI INC.

La Guadeloupe, Frontenac, P.Q.

Canada